


## Dimension of bracket / bushing for screw terminal type.


- Screw terminal type can be supplied with the following bracket and bushing.
- Here is standard position and angle of the bracket / bushing. Please contact us if you have specific requirement.
- There is a restriction for capacitors size.

### Method to mount with metal bracket

For  $\phi 35$  : 2-leg brackets(standard)

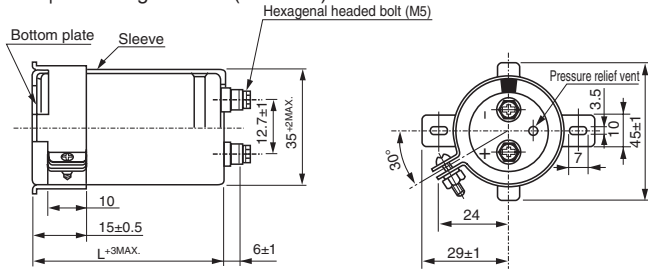


For  $\phi 51$  or greater : 3-leg brackets(standard)

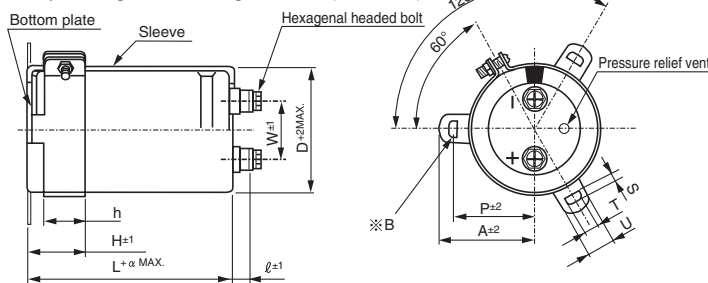

Symbol	$\phi D$				
	51	63.5	76.2	90	100
P	32.5	38.1	44.5	50.8	56.3
A	38.5	43	49.2	58.5	62
T	7.5	8	7	8	8
S	5	5	5	5	5
U	12	14	14	18	16
H	20	25	30	35	36
h	15	20	24	25	30
W	22	28.6	31.8	31.8	41.5
$\ell$	6	6	6	6	10
$\alpha$	3	3	3	3	4


Applicable to  $\phi 51$  or greater : 2-leg brackets

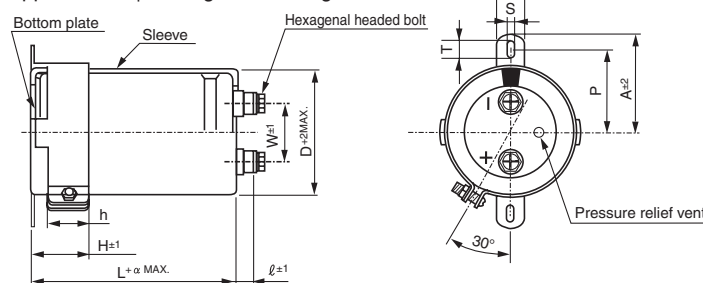


Symbol	$\phi D$			
	51	63.5	76.2	90
P	33.2	40.5	46.5	53
A	40	46.5	53	59
T	6	7	6	6
S	4.5	4.5	4.5	4.5
U	14	14	14	14
H	25	35	35	35
h	15	20	20	20
W	22	28.6	31.8	31.8
$\ell$	6	6	6	6
$\alpha$	3	3	3	3

### Method to mount with resin bushing.

Applicable to  $\phi 76.2$  and  $L \geq 150$

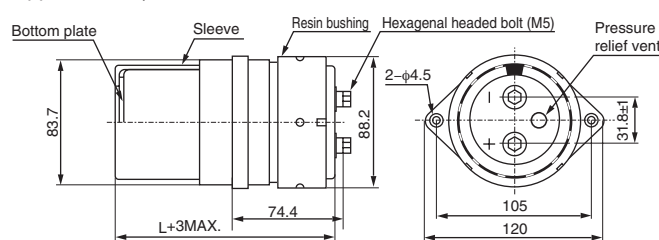


Applicable to  $\phi 90$  and  $L \geq 150$

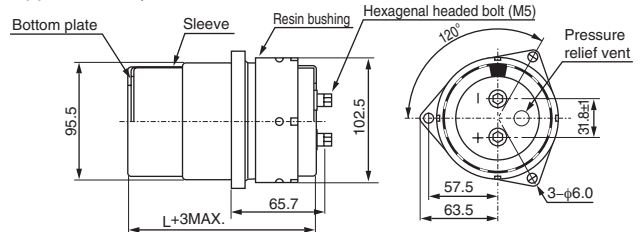


### Method to mount with stud bolt.

Applicable to  $\phi 51$  to  $\phi 90$

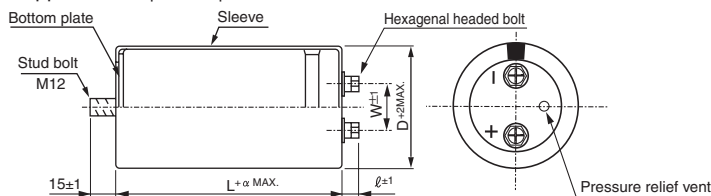


A nut for stud bolt. (option)

Plastic nut

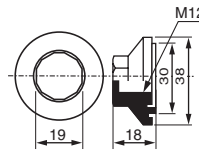

Plastic washer

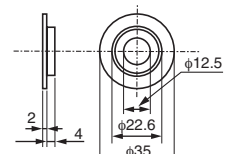

Symbol	$\phi D$			
	51	63.5	76.2	90
W	22	28.6	31.8	31.8
$\ell$	6	6	6	6
$\alpha$	3	3	3	3

※ Bracket hole :  $\phi 30.5\text{mm(MIN.)}$